

Water pump affected:

P576

Installation instructions:

- ⇒ The new "O" rings only wet with coolant!
- ⇒ Use new screws for the coolant pump


Important note:

Please, heed the specifications of the vehicle manufacturer!

Torque:

Fixing screws of the coolant pump	20Nm+90°
Mounting nut for the gear wheel	84Nm
drain screws	20Nm
Lid for the coolant pump	25Nm

ATTENTION! Important installation instructions

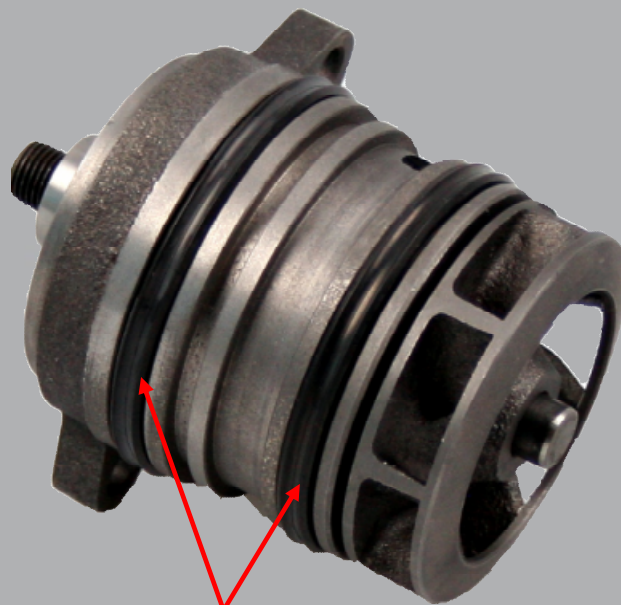

„O“-Rings

When installing, the o-rings must be wetted with coolant!

Don't use other lubricant (especially not containing mineral oil), because thereby the seals are destroyed!

Suitable for:

VW Multivan T5	2.5 TDI
VW Touareg	2.5 TDI
VW Transporter T5	2.5 TDI

Affected engine codes:

AXD AXE BLJ BNZ BPC
BAC BLK BPD BPE
AXD AXE BLJ BNZ BPC

Comparable to OE-No.:

070.121.011A
070.121.011C
070.121.011D
070.121.011DX

INFORMATION:

Corresponding spare parts can be found in our online catalog at www.hepu.de

HEPU Autoteile GmbH
Am Kreuzweg 2
D-32689 Kalletal

Tel +49(0)5264 - 6483-40
Fax +49(0)5264 - 6483-44
www.hepu.de
info@hepu.de



MADE IN GERMANY