



LuK Service Info



Part Nr. 135 0221 10 / 335 0150 10

Manufacturer: LANDINI – 16000, 16550, 17550
 MASSEY FERGUSON – 2000 & 3000 Series –
 Non Dynashift

Info: 635 1410 09 replaces / ersetzt /
 remplace / sustituye a /
 sostituisce 135 0221 10 & 335 0150 10

Art.-Nr.: 135 0221 10 / 335 0150 10



635 1410 09
635 1410 10 = 635 1410 09 + 500 0601 30



135 0221 10
 OE 3381 122 M2



335 0150 10
 OE 3615 367 M1



635 1410 09
 OE 3713 267 M00



Not interchangeable with Valeo. Flywheel pot depth must be 34mm. Do not fit shims.



No intercambiable con Valeo. Asegurese de que la profundidad del volante sea de 34mm. No instale las caizas.




Nicht mit Valeo tauschbar. Die Schwungradtiefe muss 34 mm betragen. Verwenden sie keine Distanzscheiben.



Non intercambiabile con Valeo. Assicurarsi che la profondità volante sia di 34mm. Non installare spessori.



N'est pas interchangeable avec Valeo. Assurez vous que la profondeur du volant-moteur soit de 34mm.

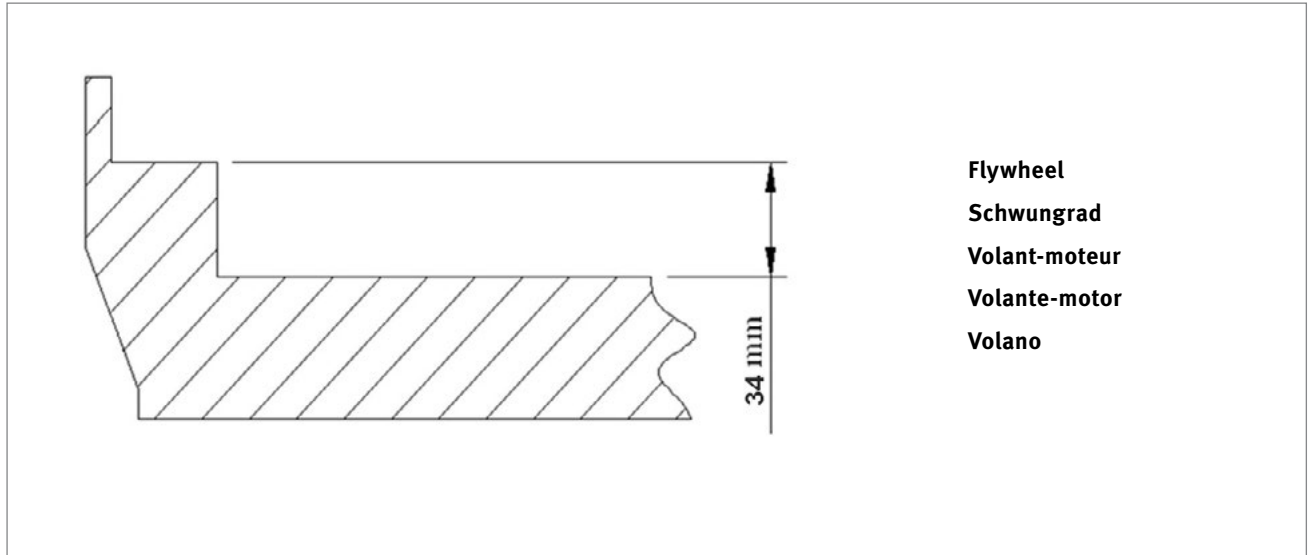

You want more? We can help!

Phone: +44 (0) 1432 264 264

Fax: +44 (0) 1432 375 760

aftermarket.uk@schaeffler.com

www.repxpert.co.uk

SCHAEFFLER
REP>XPERT