




Update Note:

Stellantis Engine 1.5l BlueHDi DV5 YH

In the 1.5 BlueHDi engine developed by Stellantis in 2019, critical issues may be encountered due to premature wear of the timing chain, a chain which, if not replaced when excessive noise occurs can break, causing extensive damage to the engine. Aware of the problem, Stellantis technicians have made significant changes to the engine since January 2023, with the adoption of an 8 mm timing chain instead of 7 mm, new camshafts and a new valve cover. To recognize the pre-modified version, it is necessary to analyze the valve cover: the updated version has two small protuberances (b) and a rounded design around the shafts (1) as highlighted in the drawing below. The original reference number has also changed: 98 305 804 80 (a).

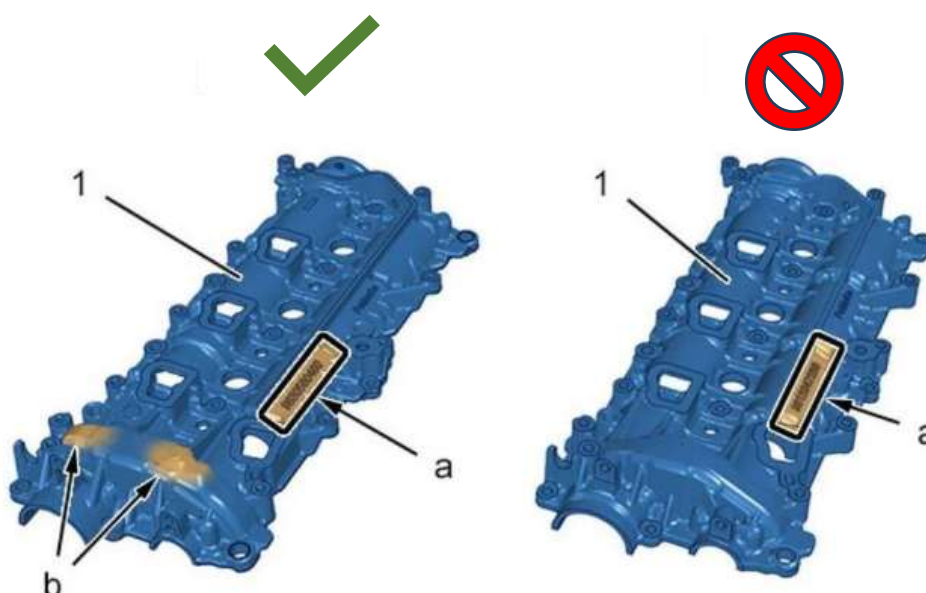

FRECCIA INTERNATIONAL srl - ENGINE PARTS

Sede Legale e operativa: via 1 Maggio 30/32, 20028 San Vittore Olona (MI), tel. +39-0331-515317, cap. soc. € 500.000,00 int.
vers. - REA MI 1402657 - Iscr. Reg. Imprese Milano 10731870159 - codice fiscale e partita IVA IT10731870159



This type of problem could affect various models, both cars and small commercial vehicles, including those listed below:

CITROEN:

C3 III, C3 Aircross, C4 III, C4 Cactus, C4 SpaceTourer, C5 Aircross, Berlingo III, Berlingo III Van, Traveler, Jumpy

DS:

DS3 Crossback, DS4 II, DS7 Crossback

OPEL / VAUXHALL:

Corsa, Mokka, Crossland, Grandland, Combo, Combo Cargo, Zafira, Vivaro

PEUGEOT:

208 II, 2008 II, 308 II and III, 508 II, 3008 II, 5008 II, Rifter, Partner, Expert

TOYOTA:

Proace, Proace City, Proace City Verso, Proace Verso

FRECCIA Solution:

Having recognized the challenges this engine faces, FRECCIA is able to provide two types of repair kits with certified quality aftermarket parts:

FRECCIA INTERNATIONAL srl - ENGINE PARTS

Sede Legale e operativa: via 1 Maggio 30/32, 20028 San Vittore Olona (MI), tel. +39-0331-515317, cap. soc. € 500.000,00 int.
vers. - REA MI 1402657 - Iscr. Reg. Imprese Milano 10731870159 - codice fiscale e partita IVA IT10731870159



FRECCIA REFERENCE – CM05-2462:

PRE-ASSEMBLED KIT



FRECCIA REFERENCE - CM05-2441

1X KIT PRE-ASSEMBLED - CM05-2462

16X TAPPETS - PI 06-0058 / OE: 9819917580

16X ROCKER ARM - RA06-1009 / OE: 1692287080

8x VALVE IN - R8017/SCR / OE: 9814152480

8x VALVE OUT - R8022/RCR / OE: 9814152380



FRECCIA INTERNATIONAL srl - ENGINE PARTS

Sede Legale e operativa: via 1 Maggio 30/32, 20028 San Vittore Olona (MI), tel. +39-0331-515317, cap. soc. € 500.000,00 int.
vers. - REA MI 1402657 - Iscr. Reg. Imprese Milano 10731870159 - codice fiscale e partita IVA IT10731870159